



XTAR® SN4

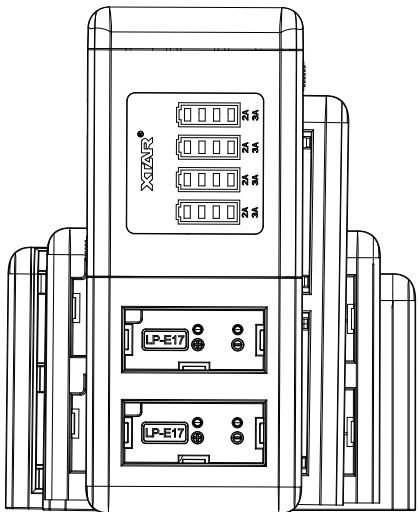

Introduction

The Fastest Multi-Camera Battery Charger

SN4 is a smart charger for camera batteries with LCD screen, compatible with many camera batteries by simply swap battery charger plates, and it can accommodate up to 4 camera batteries at one time. With Type-C input, it supports PD3.0&QC3.0 fast charging and its max. input power reaches 45w. It has three optional charging currents (1x3A/ 2x2A/ 4x1A).

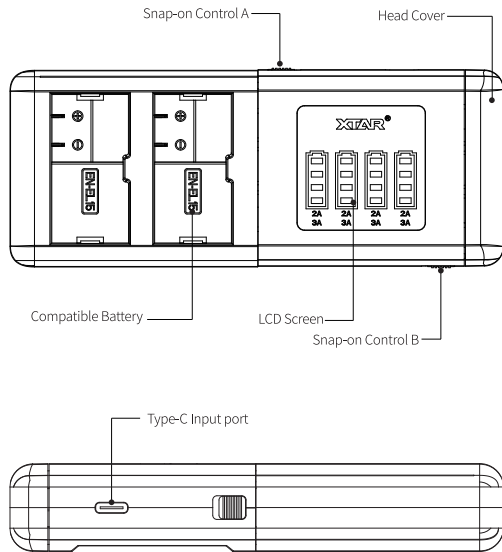

Parameters

Model	SN4
Power Input	PD3.0 (15V3A) & QC3.0 (12V1.5A)
Constant Current	8.4V3Ax1/2Ax2/2Ax1/1Ax4/0.5Ax4
End-of-Charge Voltage	8.4±0.1V
End-of-Charge Current	≤150mA
Operating Temperature	-5°C~40°C

Operation

1. Connect to power, the screen lights up; the charger enters standby mode.
2. At standby mode, slide camera battery into corresponding slot.

SN4 will automatically choose the most suitable charging current base on inserted battery quantity, adapter type and internal resistance of battery. For details, see below table:

Inserted battery quantity Charging current Adapter type	1	2	3	4
PD45W	3A x 1	2A x 2	1A x 3	1A x 4
PD30W	3A x 1	1.5A x 2	1A x 3	0.75A x 4
QC3.0	2A x 1	1A x 2	0.5A x 3	0.5A x 4
5V 2A	1A x 1	0.5A x 2	0.25A x 3	0.25A x 4

Note: When the charging current is around 3A, the 3A icon on screen lights up; around 2A, the 2A icon lights up; less than 2A, current status will not be displayed.

3. During charging process, the LED bars on the screen show as below:

Lighting ways LED bar	Power level	0—25%	25—50%	50—75%	75—99%	100%
4st LED bar	Flashing	Flashing	Flashing	Flashing	Light up	Light up
3st LED bar						
2st LED bar						
1st LED bar			Lights up			

4. It will automatically terminates the charge when the battery is full, please take out the battery.

5. Remove charger head from body part takes four steps:

Step1: face the side with snap-on control;

Step 2: one hand pushes snap-on control to the other end;

Step 3: another hand pushes the body part toward yourself;

Step 4: take off the charger head. And vice versa.

Tips

1. When supply voltage is low, SN4 relatively reduces the charge current.
2. It is recommended to use PD 3.0 or QC 3.0 fast charging adapter.
3. Use of incompatible batteries will damage the charger and batteries.
4. Do not use the charger under sun exposure, moist (raindrops) or heavy dust.
5. Do not disassemble or modify the charger.
6. It is not allowed to use the charger when broken.
7. Place the device beyond the reach of a child.
8. Do not remove the charger head & body parts while charging.
9. Do not connect to power or place in a battery while joining charger head & body parts.
10. Please visit www.xtar.cc for more updated information.

After-sales

After-sales service is available when warranty number is provided to the dealer. XTAR provides:

- Replacement at no cost within 15 days
- 24-month warranty. Or beyond 24 months, free maintenance can be provided only with extra charge for replaced parts. Our dealer will inform you of any material cost or freight charge before maintenance service.
- Lifelong technical support.

Note:

1. Failure incurred by improper use or storage is not entitled to free replacement and maintenance.
2. Warranty number (9 to 11 digits) can be found at the package or on product.

After-sales Email:service@xtar.cc

Anti-counterfeit inquiry

1. An 18-digit number will show after scratching off the anti-counterfeit label on the package.
2. Enter the number onto the query page of www.xtar.cc (Contact Us - Anti-counterfeit)




Facebook



Shenzhen XTAR Electronics Co., Ltd
Address: 5th Floor, No.77 Xinhe Rd, Shangmugu, Pinghu Area,
Longgang District, Shenzhen , Guangdong, China
Zip Code: 518111 Website: www.xtar.cc
Email: info@xtar.cc Tel: +86-755-25507076
Fax: +86-755-25507076


XTAR® SN4

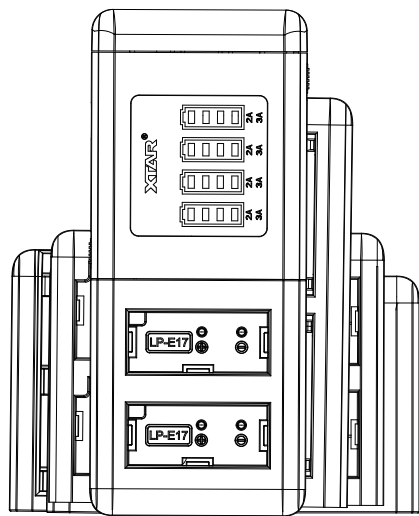

简介

百变兼容·45w PD快充

SN4是一款带显示屏的相机充电器，四槽可拼接，只需要更换相对应的充电底座，就能兼容多种电池，实用方便。搭配Type-C输入，支持PD3.0&QC3.0快充，输入功率可达45W。1x3A / 2x2A / 4x1A三种速率充电可选。

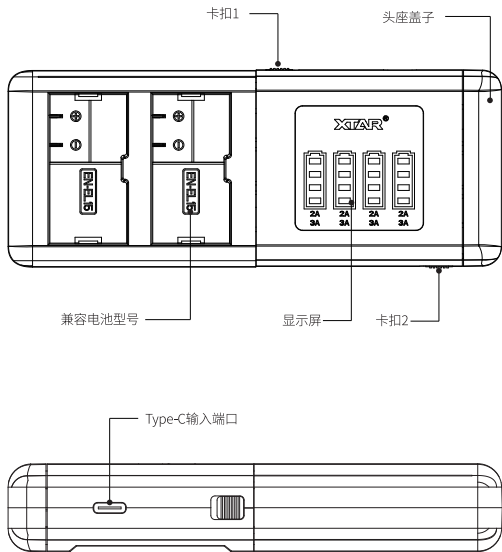

技术参数

型号	SN4
电源输入	PD3.0 (15V3A) & QC3.0 (12V1.5A)
恒定电流	8.4V■3Ax1/2Ax2/2Ax1/1Ax4/0.5Ax4
充电截止电压	8.4±0.1V
充电截止电流	≤150mA
工作温度	-5°C~40°C

操作

1. 充电器接通电源，显示屏亮，进入待机状态。
2. 待机状态下，将电池正确放入充电器槽内。

SN4将根据检测到的适配器类型，装入电池数量，电池内阻自动匹配充电电流，详见下表：

充电电流 适配器类型	电池数量	1	2	3	4
PD45W		3A x 1	2A x 2	1A x 3	1A x 4
PD30W		3A x 1	1.5A x 2	1A x 3	0.75A x 4
QC3.0		2A x 1	1A x 2	0.5A x 3	0.5A x 4
5V 2A		1A x 1	0.5A x 2	0.25A x 3	0.25A x 4

备注：当充电电流为3A，屏幕上的3A常亮，当充电电流为2A，屏幕上的2A常亮，当充电电流小于2A，将不显示电流。

3. 充电过程中，充电器电量格子显示如下：

闪光灯状态 电量格子	充电电量	0—25%	25—50%	50—75%	75—99%	100%
电量第四格	跑马闪	跑马闪	跑马闪	跑马闪	常亮	常亮
电量第三格						
电量第二格						
电量第一格			常亮	常亮		

4. 充电完成后，充电器将自动停止充电，此时拔出电池即可。

5. 拆分充电头和电池座的步骤为：面向卡扣一面，一只手将卡扣推至另一端，另一只手把充电底座往朝向自己的方向推动，即可拆分开充电头和充电座。反之亦然。

温馨提示

1. 电源电压不足时，充电器将对应降低充电电流。
2. 为更好体验SN4快充效果，建议您搭配使用PD 3.0或QC 3.0快充适配器。
3. 请勿使用非适配电池以免损坏电池和充电器。
4. 请勿在阳光曝晒、潮湿(雨水)、灰尘严重环境下使用充电器。
5. 请勿拆卸或改装充电器，严禁在损坏的情况下使用充电器。
6. 请将本产品置于儿童接触不到的地方。
7. 请勿在充电器工作时拆分充电头和电池座，请勿在充电头和电池座装配过程中接入电源和放入电池。
8. 获取更多最新信息，请访问www.xtar.cc。

售后服务

请向经销商提供保修编号以获得售后服务。XTAR将提供以下服务：

- 15天免费换新。
- 24个月内免费保修。若问题发生在24个月之后，我们将提供免费维修服务，但收取所用零件的费用。经销商会在维修前通知您材料费及相关费用。
- 终身技术支持。

注意：

1. 因用户使用、保管不当而产生的故障不享有免费包换和保修。
2. 保修编号 (9-11位) 可在包装或产品上找到。

售后服务邮箱:service@xtar.cc

防伪查询

1. 刮开包装上的防伪标签，得到18位数字。
2. 在官网查询页面输入防伪码: www.xtar.cc - 联系我们 - 防伪查询。



微信公众号



深圳市爱克斯达电子有限公司
地址: 广东省深圳市龙岗区平湖街道上木古社区新河路77号5楼
邮编: 518111 官网: www.xtar.cc
邮箱: info@xtar.cc 电话: (+86) 755-25507076
传真: (+86) 755-25507076